




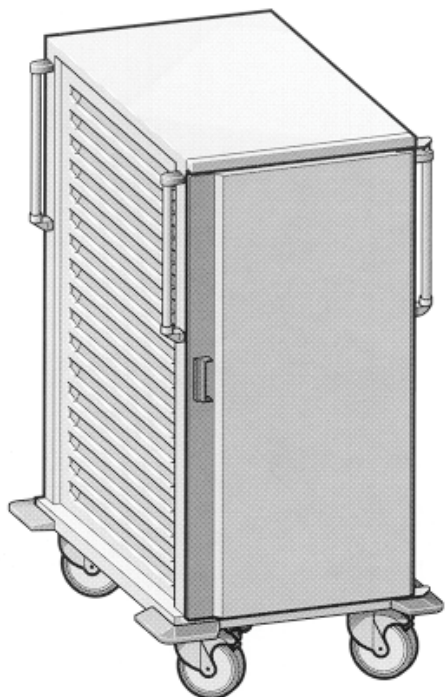

TTW-F20 ESEU

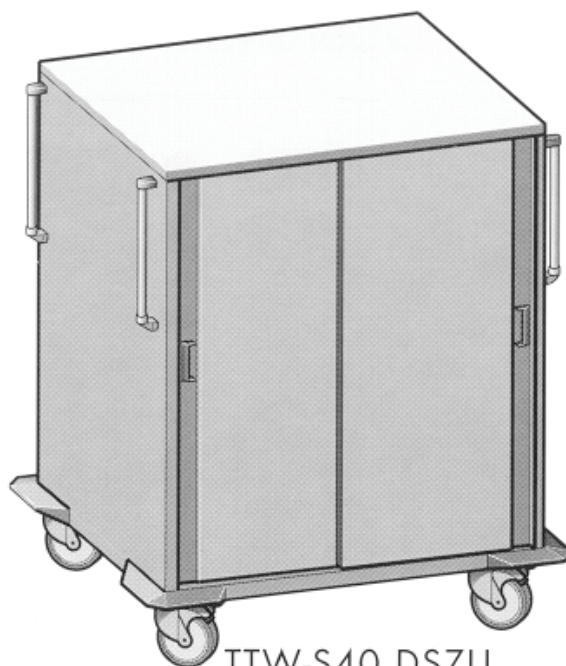

TTW-S40 DSZU

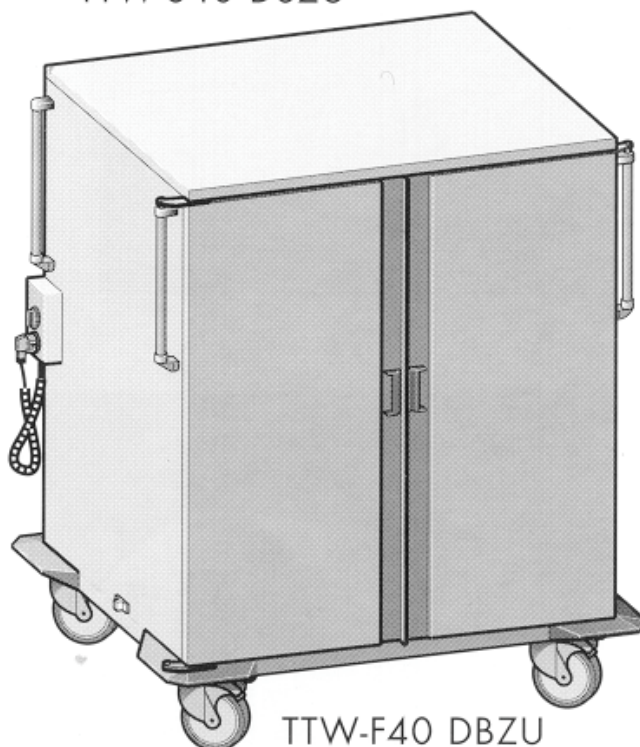

TTW-F40 DBZU





BLANCO
TABLETT-TRANSPORTWAGEN - ECO-LINE
GEBRAUCHSANWEISUNG




technical
documentation

BLANCO


Bedienung • Operation

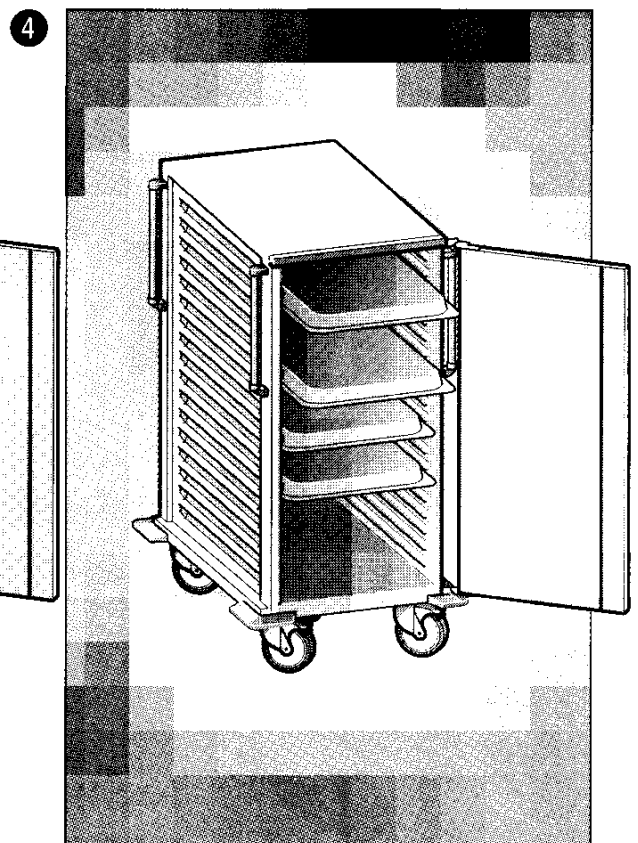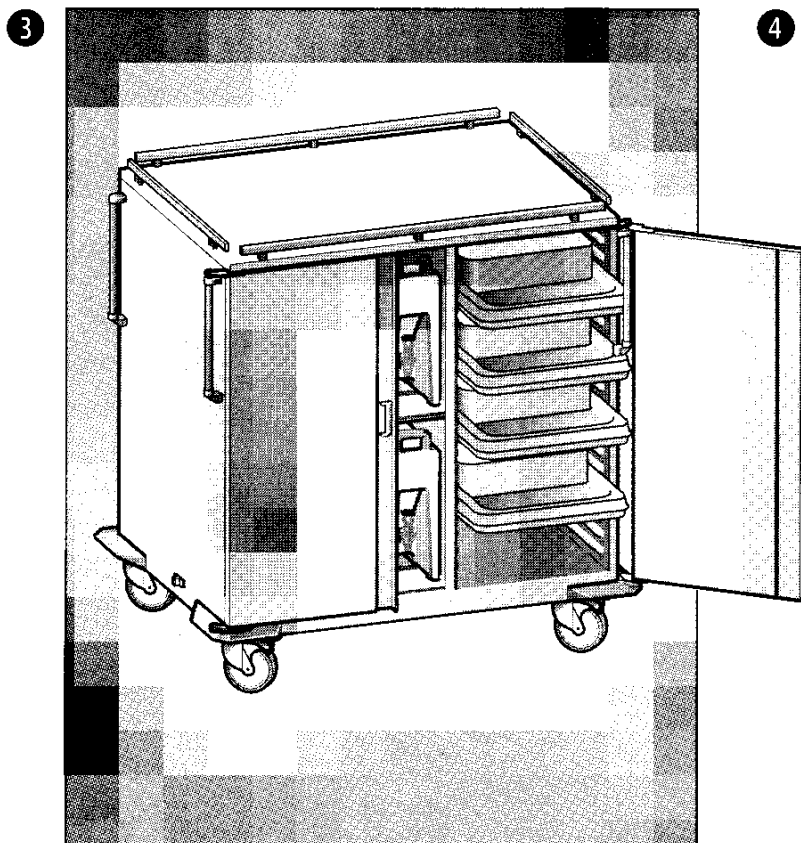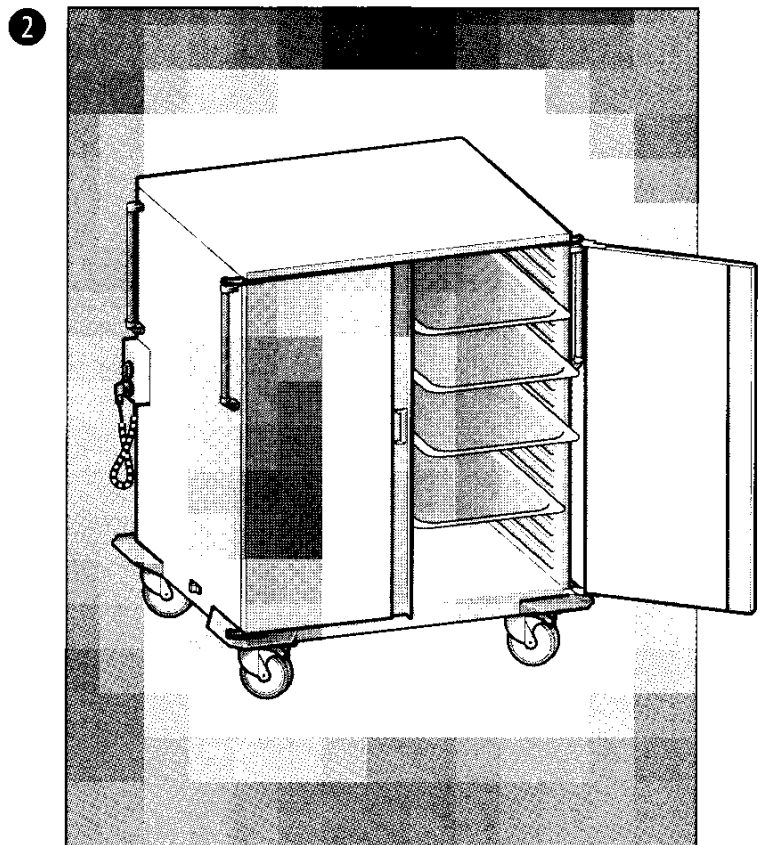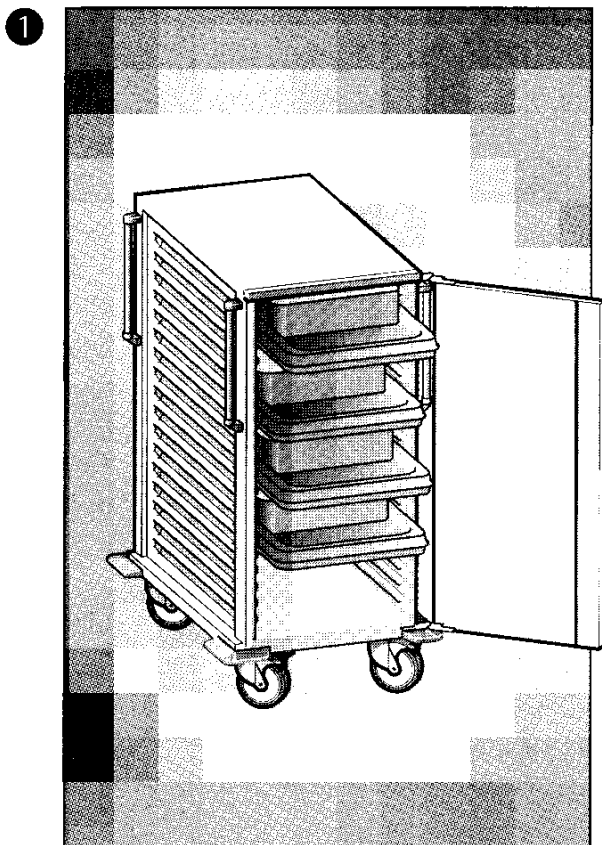

5

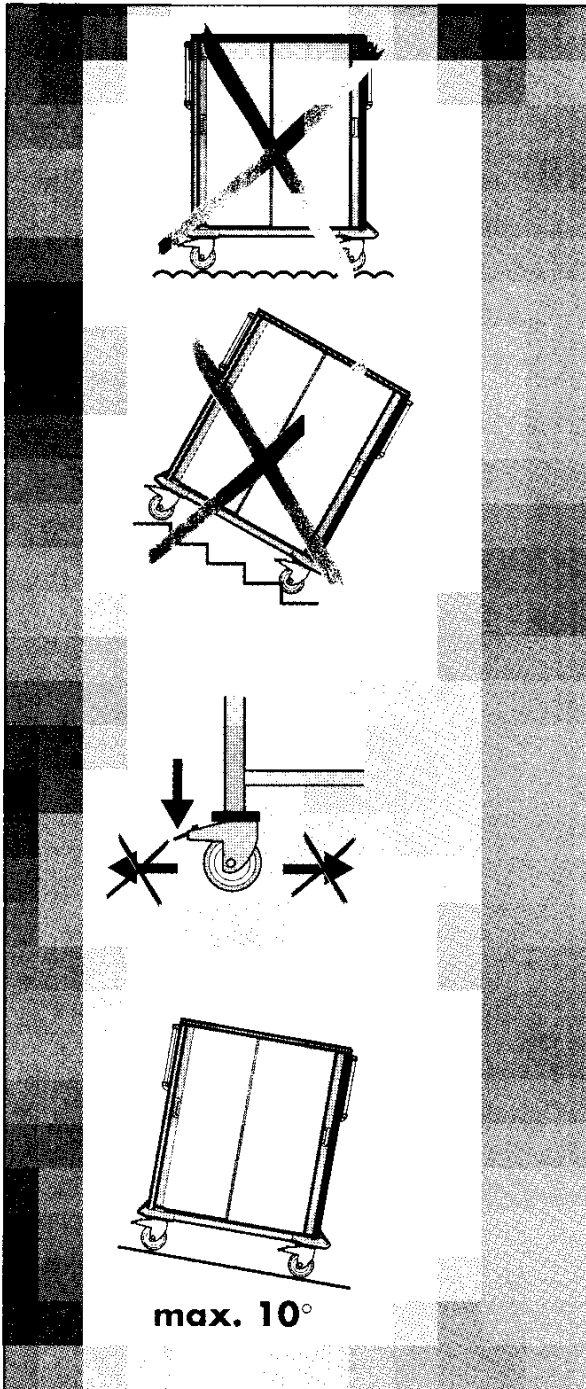


6

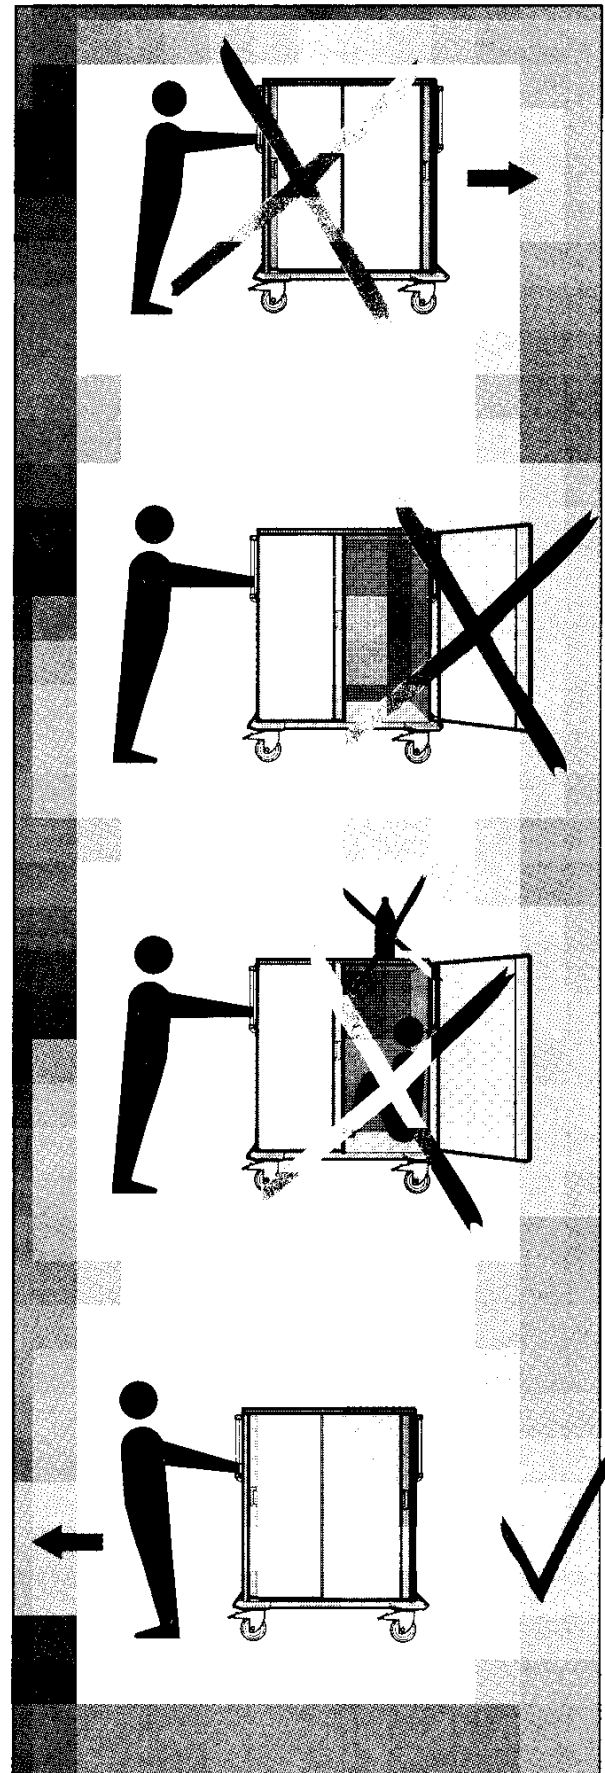


Einschalten • Switching on

7

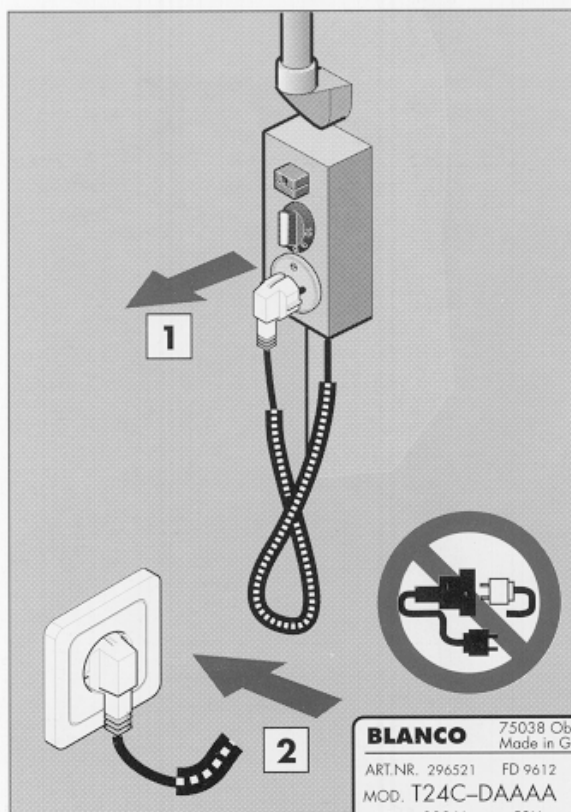


BLANCO 75038 Oberderdingen
Made in Germany
ART.NR. 296521 FD 9612 G5: Kna
MOD. T24C-DAAAA
NETZSP. 230 V ~ 50Hz 1,75 KW
HEIZKÖRPERSP. 230 V NENNSTR. 7,6 A
001001
CE


9




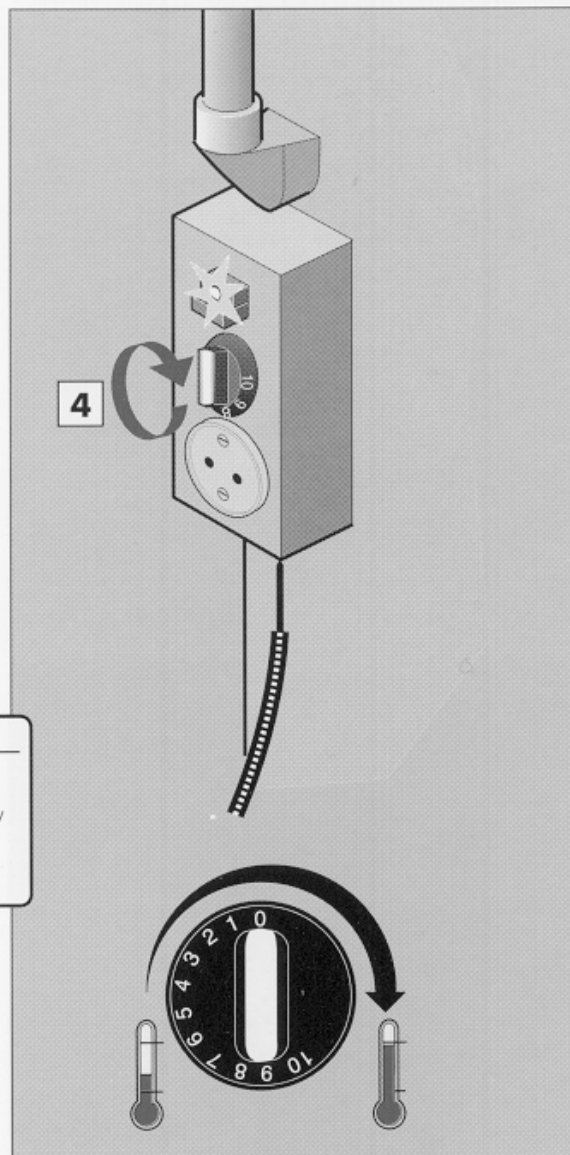


8

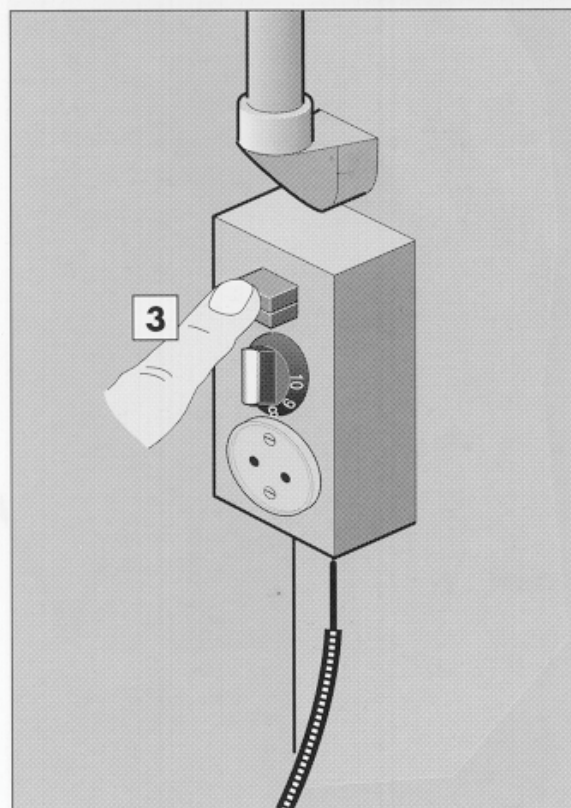


10

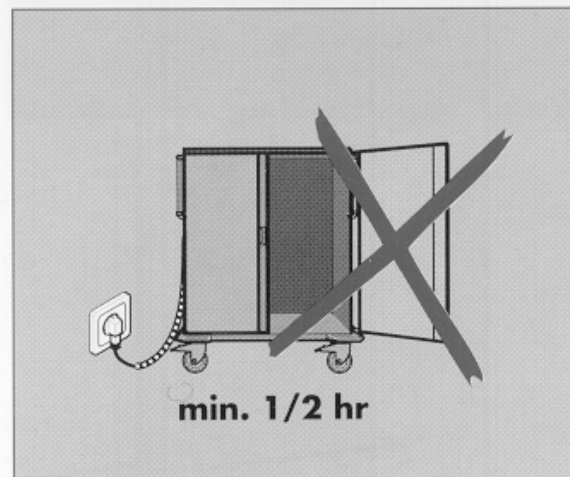


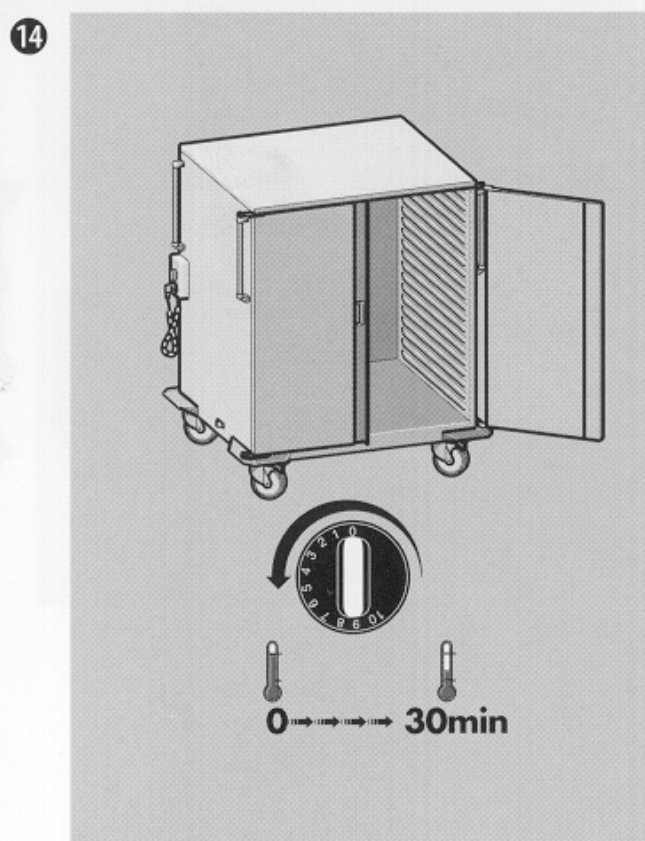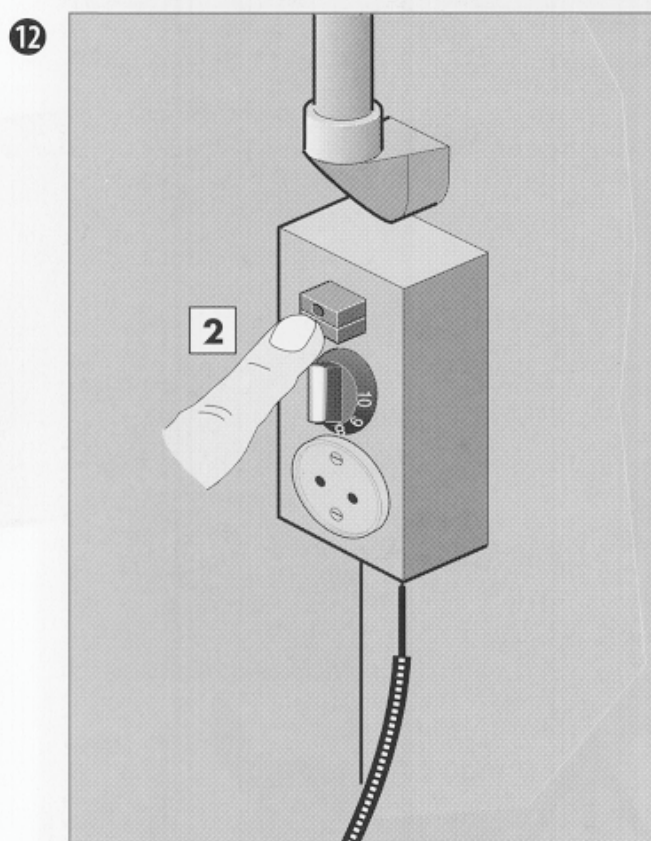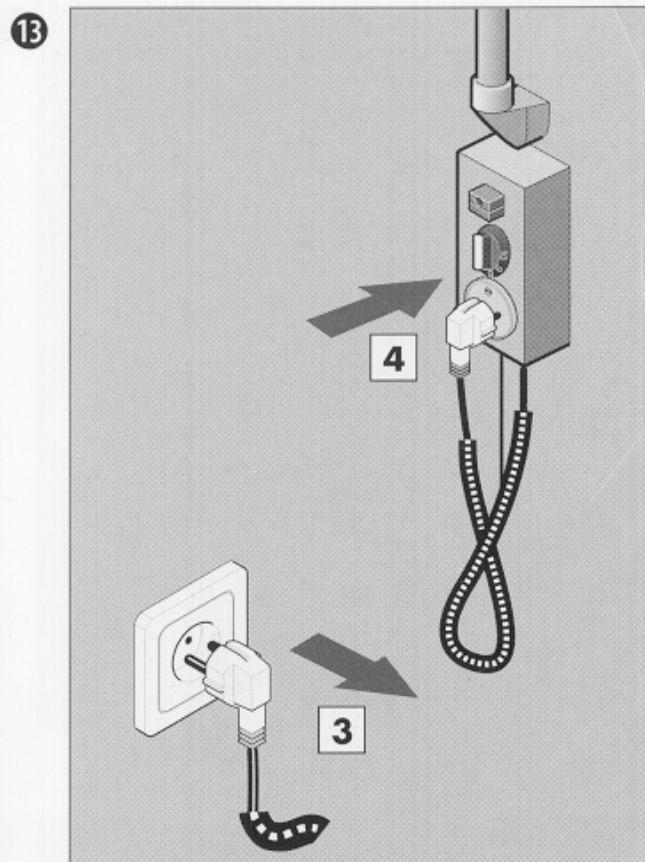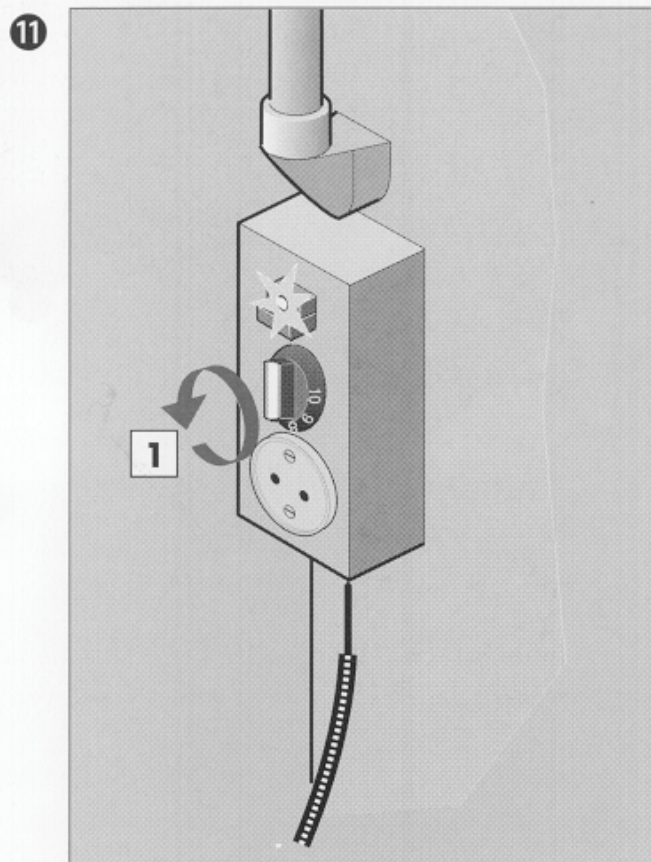


15

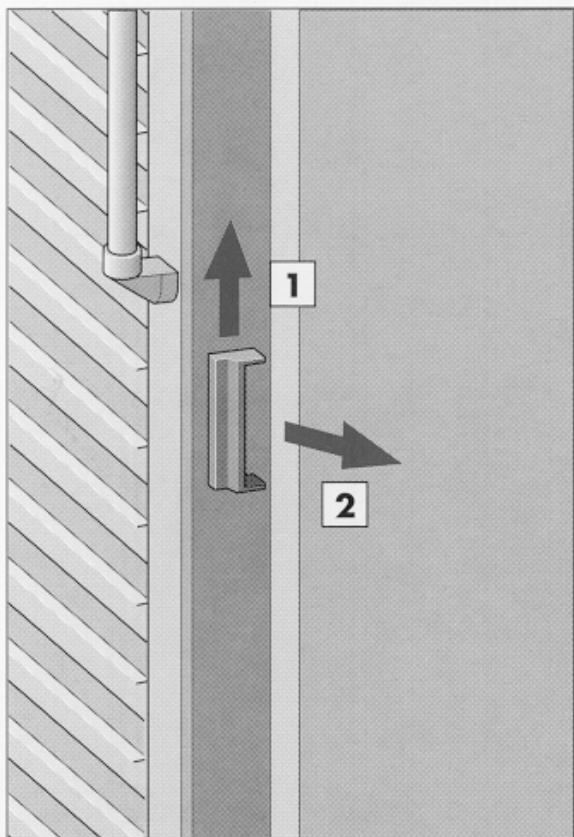



17

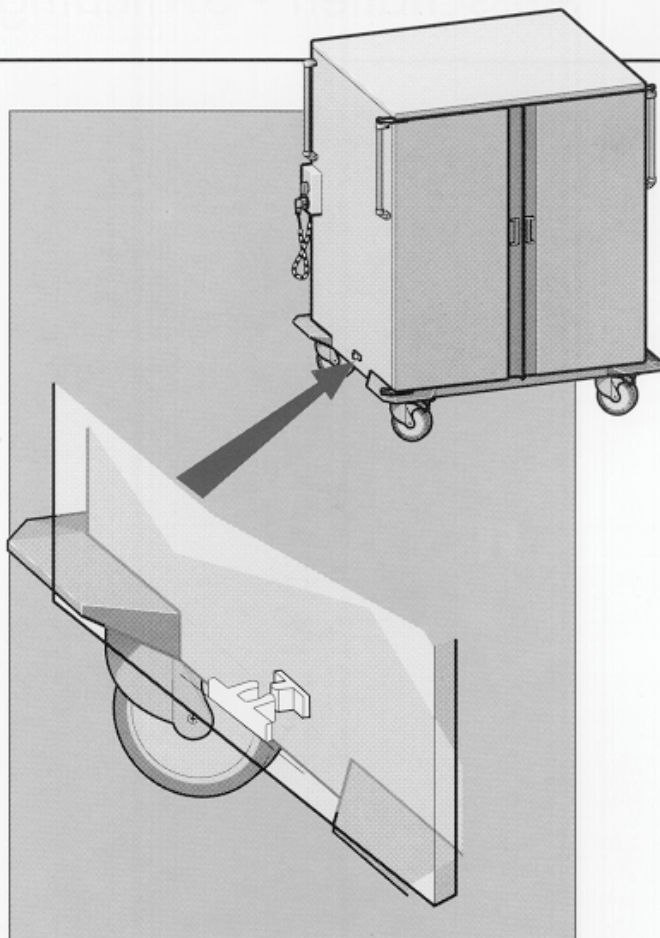


16

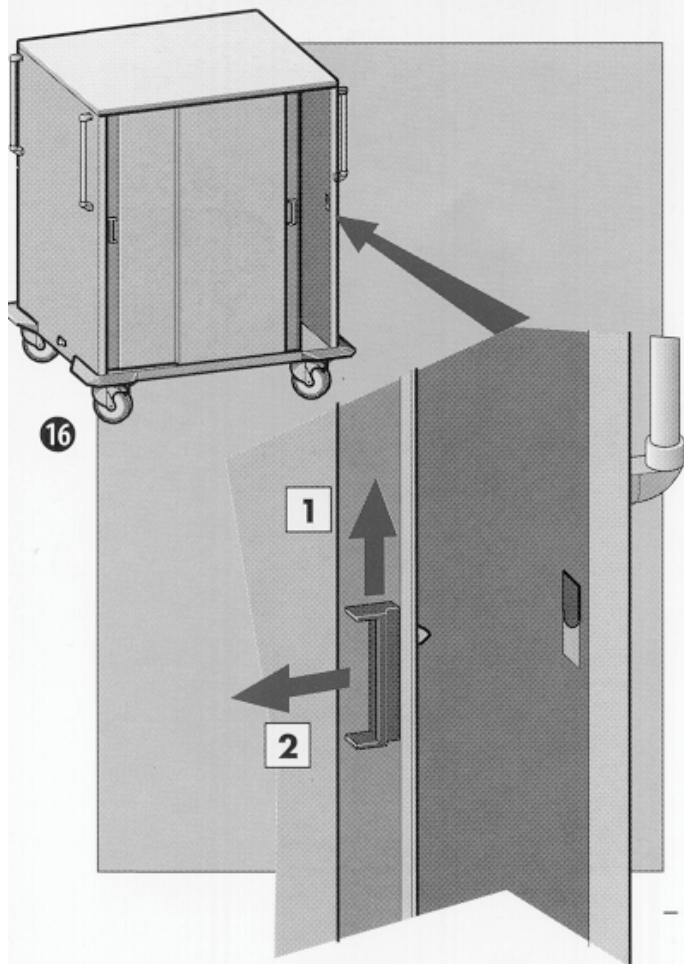


18

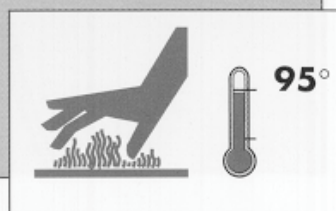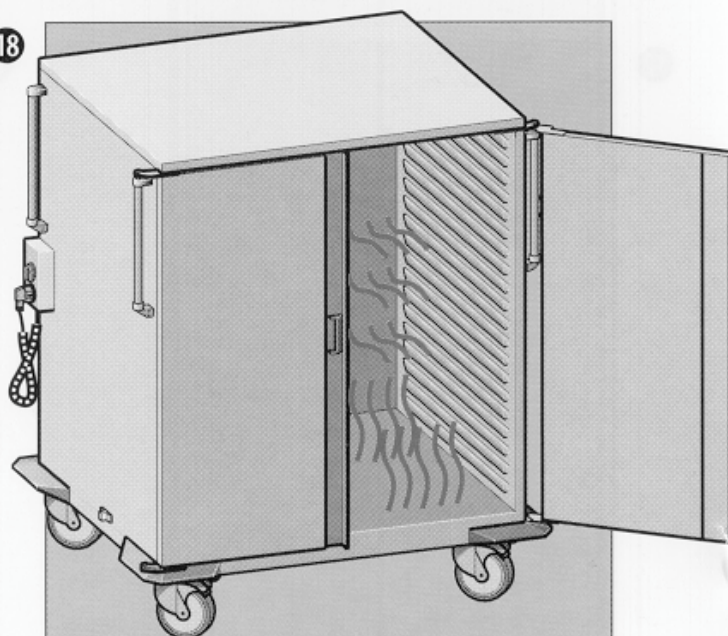

19

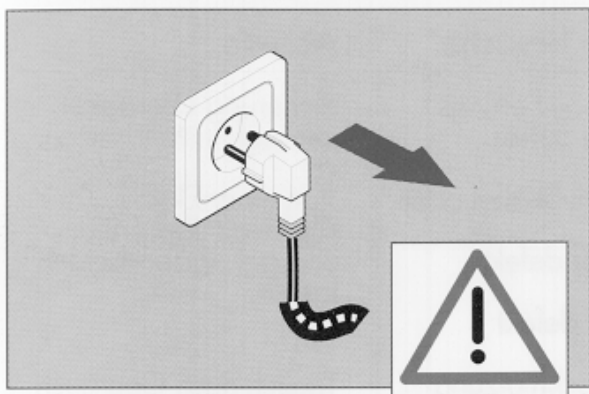


21

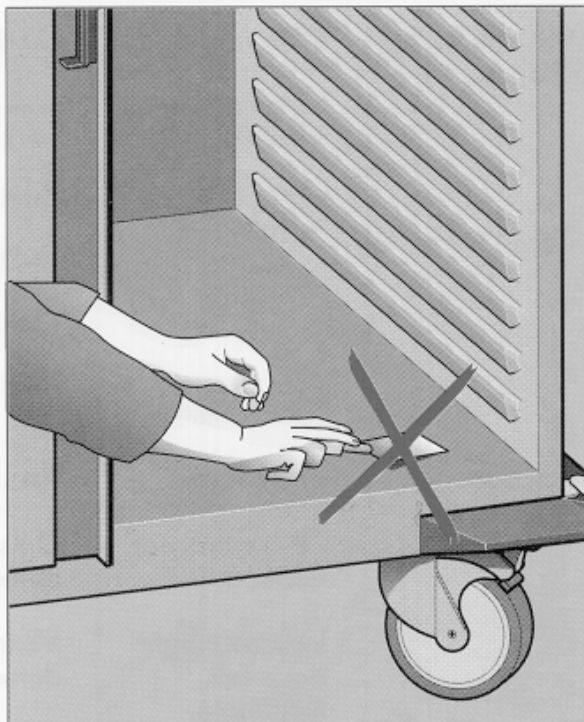

20



22

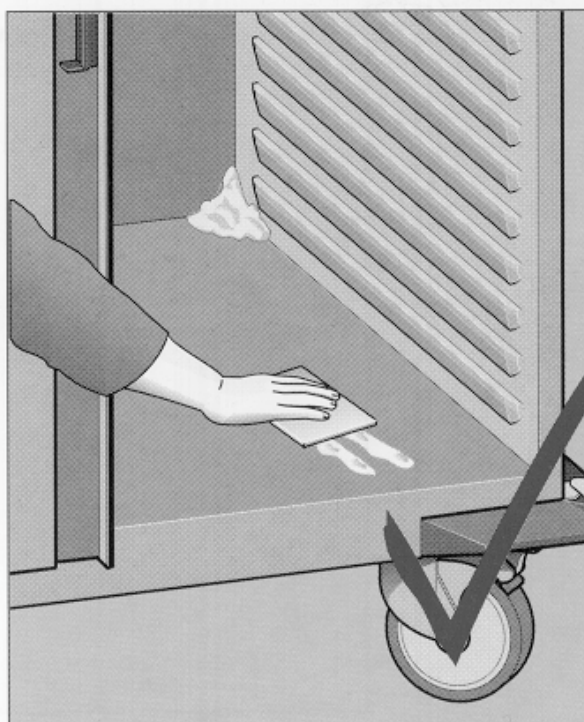

Störungen • Troubleshooting

Verhalten bei
Störungen

Trouble-
shooting

Störung	Mögliche Ursache	Abhilfe
Schrankraum wird nicht warm.	Bauseitige Sicherungseinrichtung defekt.	Sicherung überprüfen und ggf. instandsetzen.
Kontrollleuchte leuchtet nicht.	Netzanschlußkabel oder Netzstecker defekt Schaltkreis defekt	Von einer Elektro-Fachkraft überprüfen und ggf. instandsetzen lassen.
Korrosion an Edelstahlteilen	Starke Verschmutzung	Täglich nach Gebrauch reinigen.
Problem	Possible Cause	Remedy
TTW does not heat up.	On-site fusing device defective.	Inspect fusing device and repair if necessary.
Indicator light does not illuminate.	Mains cable or plug defective. Switching circuit defective.	Have fault examined and rectified by a qualified electrician.
Corrosion of stainless steel parts	Heavy soiling, lime build-up	Clean, de-scale and rinse thoroughly with water daily after use.

BLANCO

BLANCO GmbH +Co.KG

Abt. Service

Flehinger Str.59

D-75 038 Oberderdingen

Tel.: 07045/44 419 Fax: 07045/44 508

Service:

